


SERVICE LETTER SL51 66-11200 & 66-12200


1. Release Date: 11/17/2021
2. Service Letter No.: SL51 66-11200
3. Subject: Water Rudder Rigging Installation
4. Part/Assembly No.: 66-11200 and 66-12200
5. Float Models Affected: 6650 and 6750 on Daher KODIAK 100 AMPHIBIAN OR SEAPLANE
6650 Model Floats, Serial Numbers – 184-185 and previous
6750 Model Floats, Serial Numbers – 106-107 and previous
6. Compliance: Mandatory Recommended Optional
7. Approval: All information provided is in accordance with approved data.
8. Corrective Action: Non-required.
9. Estimated Time Required: 1.5 hours
10. Payments: Credit to Customer Under Warranty Customer Pays

The balance cable is chafing paint from the rear of the rear spreader, likely due to turbulence in that region. This service letter is recommending the addition of a set of cable guides (56-15270) to the spreader to prevent chafing as well as using anti-chafe tape.

WAS:

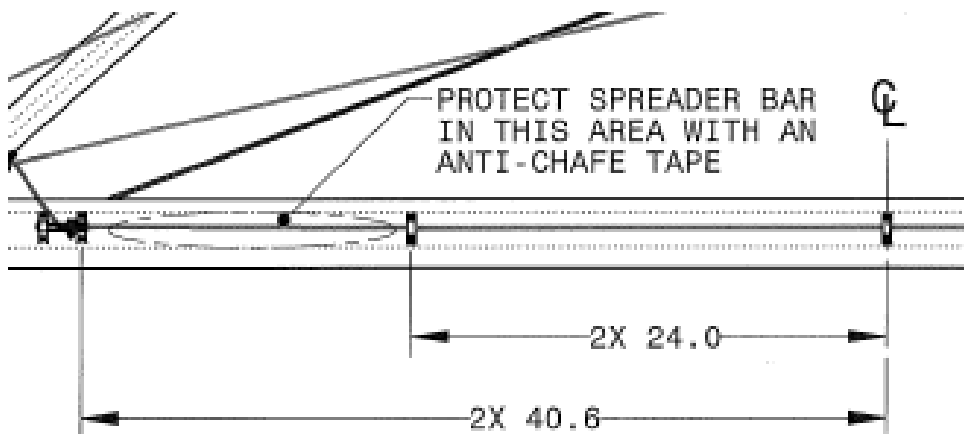

IS:

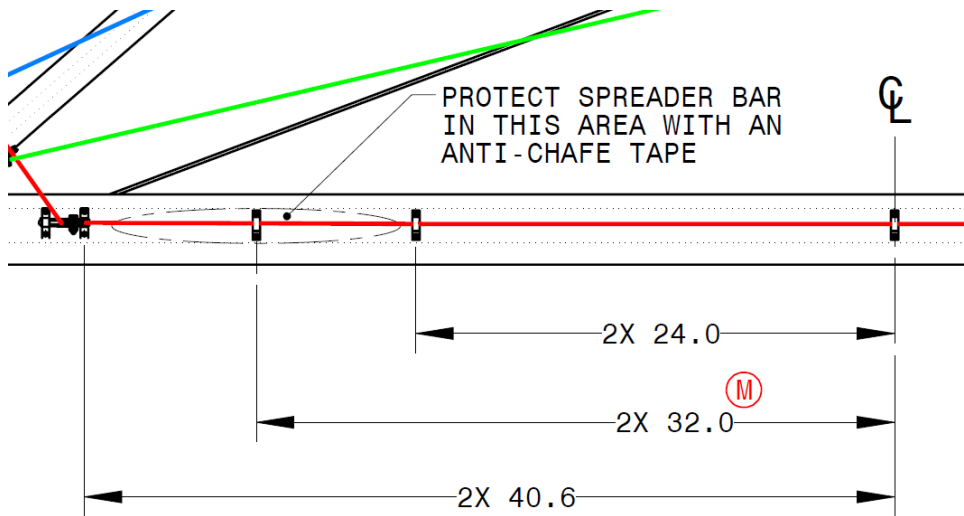

The balance cable (66-12220-17) must be uninstalled to add two cable guide assemblies; one LHS and one RHS of the rear spreader as shown above.

CR3223-4-04 Cherrymax Rivets are supplied with 56-15270(2X).

This is a good opportunity to inspect and replace as necessary the liner bushings used in the cable guides. The part number for these is RSI-0507-06; available from Aerocet, Inc.

PARTS KIT FOR 66-11200				
ITEM NO.	QTY	TYPE	PART NUMBER	DESCRIPTION
1	2	ASSY	56-15270	CABLE GUIDE ASSEMBLY

-END-