This Service Letter has been superseded by SL54 65-45000



- 1. Release Date: 10/05/2018
- 2. Service Letter No.: SL35 65-45000 Rev A
- **3. Reason for Change:** Improve spring retention in case of breakage and improve manufacturing and assembly.
- 4. Part/Assembly No.: 65-45000
- 5. Float Model Affected: 6650
- 6. Disposition of Product in Field: Recommended
- 7. Approval: All information provided is in accordance with approved data.
- 8. Corrective Action: Replace hardware to retain main landing gear spring.
- 9. Time Required: Under 1 hour
- 10. Payments to customer: None. Call (208) 448-0400 for Parts Department

NOTE: This revision is to clarify the need for spacers at both the upper and lower spring bracket.

Instructions:

- 1. Replace MS51957 flat washer (or MS 15795-852) with 35-80058 extension spring spacer (new). See Figure 1 page 2.
- 2. Replace spring bushing attach bolt AN4-11 (or AN4-14A) with 35-80060 corrosion resistant, extended thread bolt (new). See Figure 2 page 3.

Parts Kit

ltem No.	Qty Per Float	Туре	Part Number	Description	
9	4	PART	35-80058	SPACER, EXTENSION SPRING	
10	2	PART	35-80060-11	BOLT, CORROSION RESISTANT, EXTENDED THREADS	
11	2	PART	35-80060-13	BOLT, CORROSION RESISTANT, EXTENDED THREADS	
12	4	PART	35A-45035	SPRING BUSHING	
15	2	PART	35A-45095	EXTENSION SPRING	
41	4	HRDWR	AN316C4R	JAM NUT, STAINLESS, RH THREADS	
47	4	HRDWR	MS17825-4	NUT, SELF-LOCKING, CASTELLATED, NON-METALLIC INSERT	
53	4	HRDWR	MS24665-153	COTTER PIN	
59	8	HRDWR	NAS1149C0416R	WASHER, FLAT, STAINLESS	
60	4	HRDWR	NAS1149C0463R	WASHER, FLAT, STAINLESS	



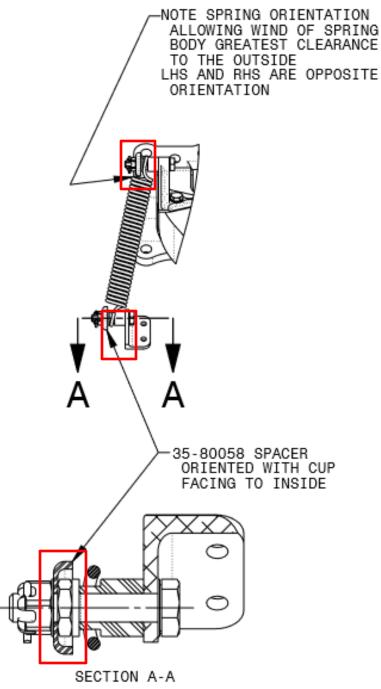


Figure 1 Extension Spring Spacer



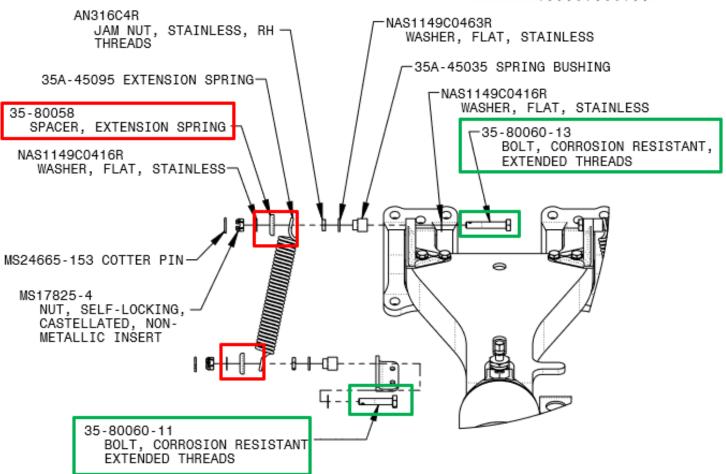


Figure 2 - Full View New Extension Spring Spacers (Red) and Corrosion Resistant Bolts with Extended Threads (Green)

Rev	Date	Summary of Change	Authorized by
I/R	08/16/2018	Initial Release	LM
А	10/05/2018	Added revision record.	LM