

Service Letter #: SL19 66-12700

Initial Release Date: October 14, 2016

Part #: 66-12731 Flexible Hydraulic Lines

Float Model Affected: Aerocet Model 6650 Floats, Kodiak Aircraft


Disposition of Product in Field: Installation is optional. Parts are available to order by contacting our Parts Department (208) 448-0400.

Approval: All information provided is in accordance with approved data.

Affected: Parts and Assemblies, Illustrated Parts Catalog


Reason for Change: Customer has option of switching to flexible hydraulic hose to replace hard tubing.

Time Required: 2 hours

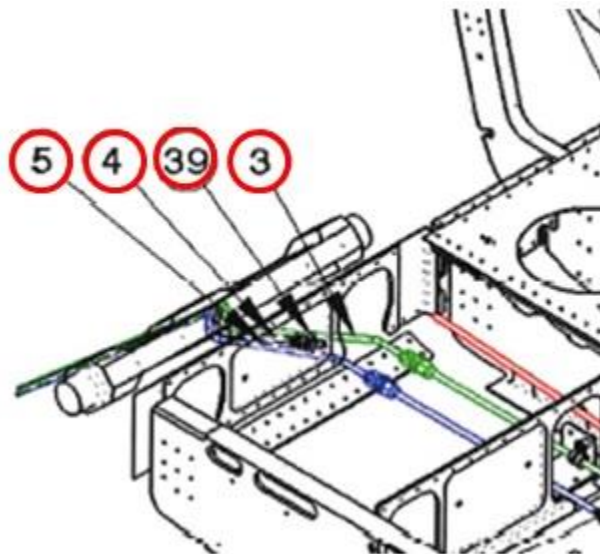

Description of Change:

1. Apply flexible spiral wrap, approximately 6" length at possible contact points where hoses exit strut, top and bottom and at float and fuselage fittings. Spirals shall not align with contact edges. Reference 66-12700 drawing

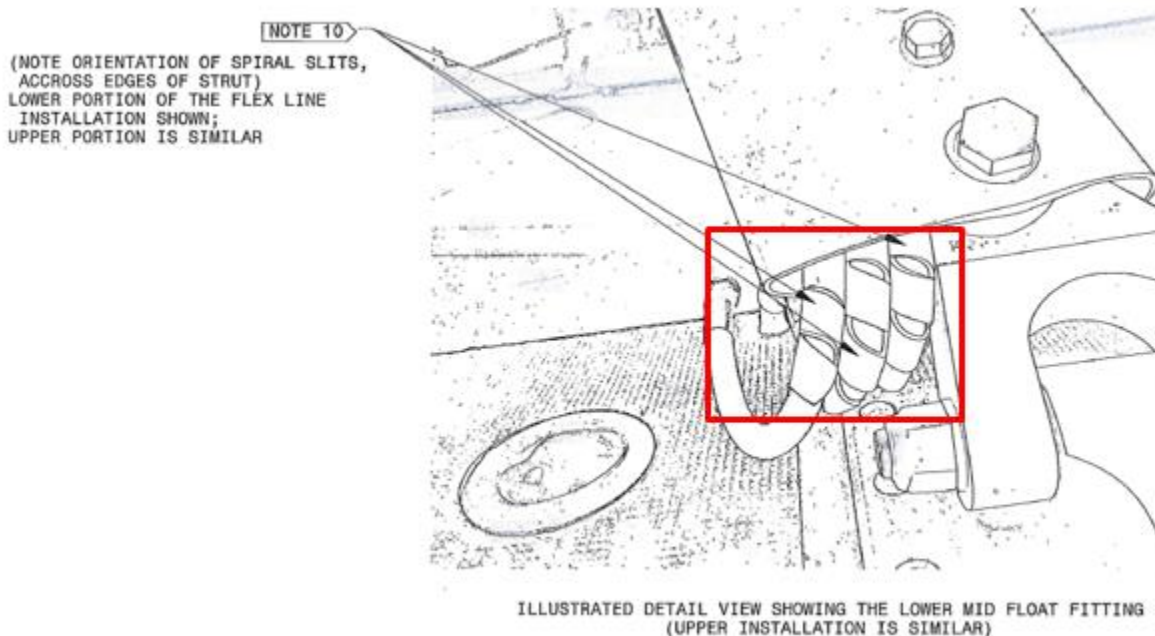

2. Use $\varnothing 1/4$ " nylon 6/6, flame retardant spiral wrap, Thomas and Betts SRNY-250-9-C or equivalent.

Partial Parts List from 66-12700 Drawing					
Item No.	QTY	Type	Part No.	Description	Optional
3	1	ASSY	66-12721	Tube, Hydraulic, #11 [Deploy LHS]	66-12731
4	1	ASSY	66-12722	Tube, Hydraulic, #12 [Brake LHS]	66-12731
5	1	ASSY	66-12723	Tube, Hydraulic, #13 [Retract LHS]	66-12731
6	1	ASSY	66-12724	Tube, Hydraulic, #14 [Deploy RHS]	66-12731
7	1	ASSY	66-12725	Tube, Hydraulic, #15 [Brake RHS]	66-12731
8	1	ASSY	66-12726	Tube, Hydraulic, #16 [Retract RHS]	66-12731
39	6	REFERENCE	AS5174D0404	Union, Flared Tube (AN8 15-4D, OBS.)	
	72"	HRDWR	2NOC	Flame Retardant Spiral Wrap	

REVISION RECORD

Rev	Date	Summary of change	Authorized by
I/R	10/14/2016	Initial Release	LM
A	08/31/2017	<ul style="list-style-type: none">• Added release date• Updated pictures and callouts	LM
B	03/21/2020	Added Revision Record	LM

-END-